

Tês de redução a 90°


Reducing tees 90°

Tês de réduction à 90°

Tes 90° reducidas



01 05 1004 000

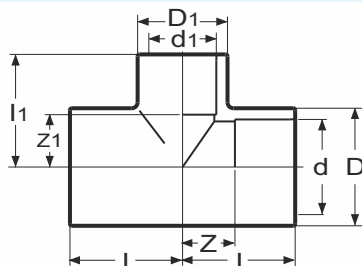

d	d1	D	D1	I	I1	Z	Z1	Gr	PN	Quant	Nº Código
25	20	31	25	33	30	13	13	28	16	B 60	01 05 1004 002
32	20	38	25	39	34	16	17	42	16	B 40	01 05 1004 004
32	25	38	31	39	37	16	17	45	16	B 40	01 05 1004 005
40	20	47	25	49	38	22	22	72	16	C 100	01 05 1004 006
40	25	47	31	49	41	22	22	74	16	C 90	01 05 1004 007
40	32	47	38	49	43	22	21	74	16	C 80	01 05 1004 008
50	20	62	28	59	44	28	28	183	16	C 45	01 05 1004 009
50	25	62	34	59	47	28	28	186	16	C 50	01 05 1004 010
50	32	62	42	59	50	28	28	190	16	C 45	01 05 1004 011
50	40	62	50	59	54	28	28	190	16	C 45	01 05 1004 012
63	50	77	65	72	65	34	34	356	16	C 26	01 05 1004 015
75	50	92	61	84	71	40	40	527	16	C 12	01 05 1004 016
75	63	92	77	84	78	40	40	548	16	C 12	01 05 1004 017
90	50	109	65	99	83	48	48	865	16	E 16	01 05 1004 018
90	63	109	77	99	86	48	48	865	16	E 16	01 05 1004 019
90	75	109	92	99	92	48	48	900	16	E 16	01 05 1004 020
110	50	132	65	119	96	58	65	1417	16	E 11	01 05 1004 021
110	63	132	77	119	96	58	58	1426	16	E 11	01 05 1004 022
110	75	132	92	119	102	58	58	1451	16	E 11	01 05 1004 023
110	90	132	109	119	109	58	58	1522	16	E 9	01 05 1004 024

Tês de redução a 90°


Reducing tees 90°

Tés de réduction à 90°

Tes 90° reducidas



01 05 1004 000

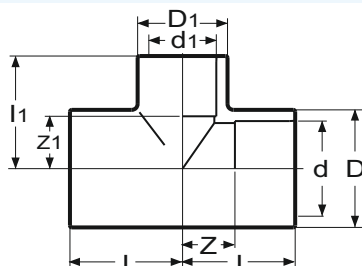

d	d1	D	D1	I	I1	Z	Z1	Gr	PN	Quant	Nº Código
125	50	145	60	135	94	66	64	1680	16	E 8	01 05 1004 033
125	63	145	75	135	101	66	64	1700	16	E 8	01 05 1004 034
125	75	145	89.5	135	107	66	64	1714	16	E 8	01 05 1004 035
125	90	145	105	135	115	66	64	1740	16	E 8	01 05 1004 036
125	110	145	129	135	125	66	64	1830	16	E 8	01 05 1004 037
160	75	188	89.5	167	125	81	81	3581	16	D 4	01 05 1004 047
160	90	188	105	167	132.5	81	81	3611	16	D 4	01 05 1004 048
160	110	188	129	167	142.5	81	81	3604	16	D 4	01 05 1004 049
160	125	188	145	167	150	81	81	3741	16	D 4	01 05 1004 050
160	140	188	162	167	158	81	81	3810	16	D 4	01 05 1004 051
315	160	356	188	332	253	167	167	19540	10	I 1	01 05 1004 076

NEW